

EXHIBIT F

THK-5-0004 USFO/H FNUM:

TD:4559179

P:2/4



American Testing Services, Ltd.
3060 East River Road
Dayton, OH 45439

On-Site Inspection Report

Customer Information

Pyramid Riggers
2076 North Broad Street
Fairborn, Ohio 45324

Date: 2-20-04
PO Number:
Job Number: ATS-MPF-471

Item(s) to be Inspected:

100% of welds on floor of chromic acid waste tank

Inspection Method(s) to be Utilized:

hand yoke S/N 1018 and 10517 dry red powder batch #038707-014

Specification or Code:

ASW D1.1 / no cracks allowed

Results of Inspection:

100% of welds on floor were inspected and were accepted at time of inspection. There was one crack located on the floor at the south end approx. 1.5" from outside wall and 2" west of the center weld. Crack is approx. 15" long. This tank is rejected.

Technician: Jeff Adams Level III
Signature on File


DC 417

MMK-5-2004 QB:SYA FROM:

TO:4559179

P: 4/4

READINGS AND LOCATIONS SIDE WALL
South

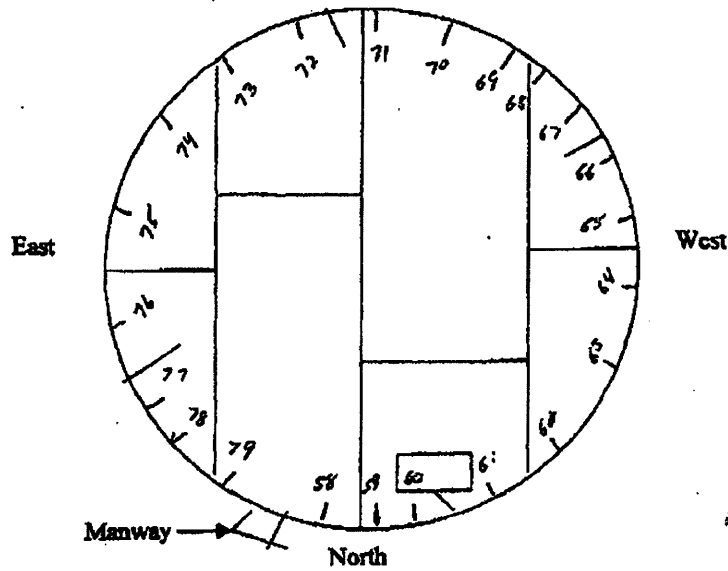

*Wall Thickness
Readings.*

Orig. 0.25 in

58.	.253	69.	.255
59.	.254	70.	.267
60.	.252	71.	.264
61.	.248	72.	.266
62.	.246	73.	.268
63.	.249	74.	.264
64.	.252	75.	.262
65.	.255	76.	.259
66.	.260	77.	.248
67.	.260	78.	.255
68.	.256	79.	.253


DC 418

MHK-5-2004 08:15/4 FROM:

TO: 4559179

P: 3/4

READINGS AND LOCATIONS OF FLOOR
South

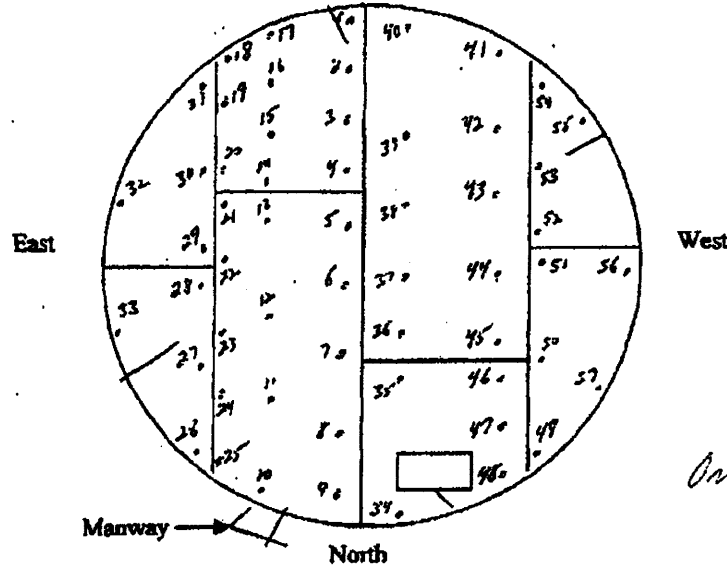

Floor reading

Orig. - 0.25 in

1. .266	16. .272	31. .264	46. .268
2. .287	17. .280	32. .263	47. .260
3. .283	18. .270	33. .262	48. .270
4. .245	19. .221	34. .244	49. .276
5. .254	20. .243	35. .268	50. .257
6. .246	21. .251	36. .250	51. .256
7. .246	22. .246	37. .258	52. .256
8. .262	23. .239	38. .246	53. .259
9. .257	24. .263	39. .268	54. .258
10. .268	25. .230	40. .253	55. .246
11. .249	26. .264	41. .248	56. .268
12. .239	27. .265	42. .266	57. .263
13. .254	28. .247	43. .257	
14. .239	29. .255	44. .253	
15. .265	30. .255	45. .257	

DC 419